

INSTRUCTIONS FOR 'TOPPINGUP' RE-TREATMENT

IMPORTANT: This procedure must be carried out every 28 days

Step 1: Thoroughly wash and dry the windows

Step 2: Wipe over the surface of the windows with the Kleentec Glass Treatment using the cotton pads, in horizontal stripes. Leave for 2 minutes for the excess liquid to evaporate, leaving a spotty appearance. Apply a 2nd coat using vertical stripes. Allow the excess liquid to evaporate. Without adding any more liquid to the pad, wipe over the whole surface to leave a smeared appearance. Streaks do not matter. For large windows you can apply the treatment using a lambswool 'T' bar.

Step 3: Leave to cure for 1 to 2 hours.

Step 4: Wash off the excess polymer haze with the Polymer Cleaner mixed with hot water and dry off the windows.

FOR SALES AND SERVICE CONTACT



KLEENTEC MARINE

BRIDGE WINDOW SAFETY SYSTEM

INSTRUCTION MANUAL

PO BOX 761, PRESTON, PR4 1GA, UNITED KINGDOM
TEL: +44(0)8705 134745 FAX: +44(0)8705 134746 MOB: +44(0)7721 304045
Email: nigel@kleentecmarine.com Website: www.kleentecmarine.com

INSTRUCTIONS FOR USE WITH STARTER KITS ONLY

Step 1: Thoroughly wash and dry the windows

Step 2: Remove any paint splashes

Step 3: Check if any of the windows have rust staining on them. If so, treat them with Rust Stain Remover. Brush a thin layer over the whole window and leave to penetrate. Depending upon the level of staining and temperature this can be anything from 3-10 minutes. Heavy staining may require a second application. Always wash off with plenty of clean water.

Step 4: For the remaining windows, thoroughly clean them with the Glass Renovator/Polish. Shake the bottle well, rub the polish into the glass surface and polish off with a soft cloth.

NB. You use either the Polish/Renovator or the Rust Stain Remover not both

Step 5: Check that all the windows are now clean, dry, and paint free.

Step 6: For small windows: Wipe over the surface of the windows with the Kleentec Glass Treatment using the cotton pads, in horizontal stripes. Leave for 2 minutes for the excess liquid to evaporate, leaving a spotty appearance. Apply a 2nd coat using vertical stripes. Allow the excess liquid to evaporate. Without adding any more liquid to the pad, wipe over the whole surface to leave a smeared appearance. Streaks do not matter.

For large windows: Use the cotton pads to apply the Glass Treatment round the edge of the glass. Apply the treatment to the rest of the window using a lambswool 'T' bar.

Step 7: Leave to cure for 3 to 4 hours.

Step 8: Wash off the excess polymer haze with the Polymer Cleaner mixed with hot water.

Step 9: Dry the windows off

Notes: In common with the use of all cleaning products you should wear gloves and if there is a risk of splashing, goggles.

The colder the temperature the longer the curing time. If temperatures are below 10°C, turn on the heated windows

The surplus products can now be used for the 'topping up' re-treatment